



COMPEX • DLI • JOHANSON MFG
NOVACAP • SYFER • VOLTRONICS

Knowles (UK) Limited
Chapman Way
Hethel, Norwich, Norfolk
NR14 8FB England

Tel: +44 (0)1603 723300
Fax +44 (0)1603 723301

Email:
Europe: KPD-Europe-sales@knowles.com
Asia: KPD-Asia-sales@knowles.com
USA: KPD-NA-sales@knowles.com

Web: www.knowlescapacitors.com

Solder Alloy Choice for Through Hole Ceramic Discoidal & Planar Array Capacitors

Introduction	2
Introduction to through hole ceramic capacitors	3
General soldering trials	5
Investigation into cause of cracks.....	7
Solder alloy trials	8
1) Solder Type 62Sn/36Pb/2Ag	9
2) Solder Type 60Sn/40Pb.....	10
3) Solder Type 99.3Sn/0.7Cu	11
4) Solder Type 95.5Sn/3.8Ag/0.7Cu	12
5) Solder Type 50In / 50Pb	13
6) Solder Type 95Pb / 5In	14
7) Solder Type 93.5Pb/5Sn/1.5Ag	15
Results Summary	16
Demonstration of effect with PdAg termination	17
Testing PdAg termination and Pb free solder alloy	18
Analysis of the Cause of failure	20
Analysis of the differences between gold plate and PdAg terminations	22
Comments on fritted termination in discoidal and planar capacitors	25
Conclusions	26
RoHS compliance	27

Introduction

It has been well known for a number of years that solder alloy choice is a critical factor in soldering to ceramic discoidal and planar array capacitors and that conventional SnPb solders have the potential to cause problems with micro-cracking of the capacitors ceramic structure. For this reason it has been common to use special solder alloys with high ductility to allow stress relief within the solder joint for this type of product.

The introduction of lead free solder alloys as a result of the EU 'RoHS' directive and other similar directives around the world has prompted further investigation into this phenomenon to categorise the effects of these alloys.

This application note aims to demonstrate the effect the choice of solder alloy has when soldering to the internal bore of these through hole capacitors.

Introduction to through hole ceramic capacitors

Through hole ceramic capacitors are based on the technology of multi-layer chip capacitors (MLCC's) with modified internal architecture. The manufacture is similar to MLCC's in that layers of ceramic dielectric material interlaced with precious metal electrodes are built up to form the structure, but holes are then drilled in the ceramic to form contacts to the inner or hot electrodes. The outside is machined to shape and makes contact to the outer or cold electrodes. The capacitance is formed between the hole and the outside edge. In the case of planar arrays, capacitance is formed between each hole and the outside edge. Within limits, each hole can have different capacitance characteristics.

Single hole devices are usually referred to as discs (they are not necessarily circular) whilst multi hole devices are referred to as planar arrays.

The materials involved are typically BaTiO₃ ceramic dielectric with PdAg electrodes. Terminations are usually plated Au over Ni directly onto the ceramic surface, or sometimes PdAg based fritted glass solderable terminations.

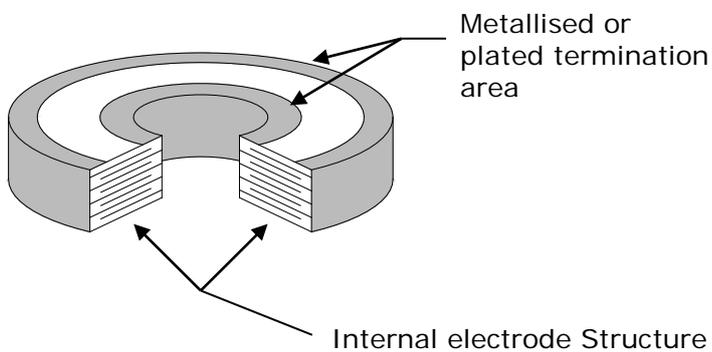


Fig 1
Typical Discoidal
Construction

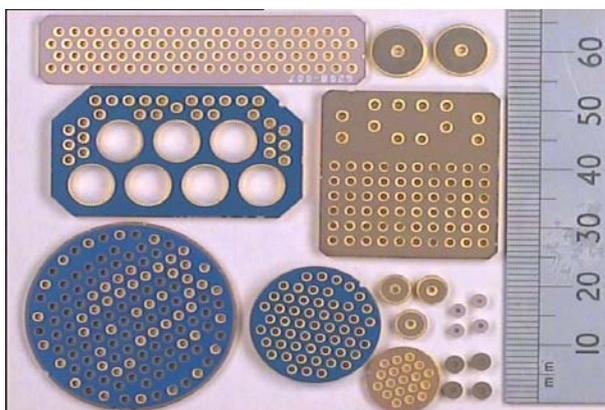


Fig 2
Examples of Discoidal and
Planar Array Capacitors

The finished capacitor device is used in the assembly of EMI filters and filter assemblies. Their special construction allows the devices to have superior high frequency performance to SM chip based filtering – important for applications such as military, aeronautical and medical. For the construction of an EMI filter, the discoidal or array is soldered into a carrying can, or body, with a pin soldered through the centre. The assembly can then be encapsulated to give improved mechanical and environmental protection. The signal to be filtered is passed through the pin and the outside of the body connected to earth.

The pin and body are usually manufactured from Cu or Cu based alloys, plated with Ag or Au.

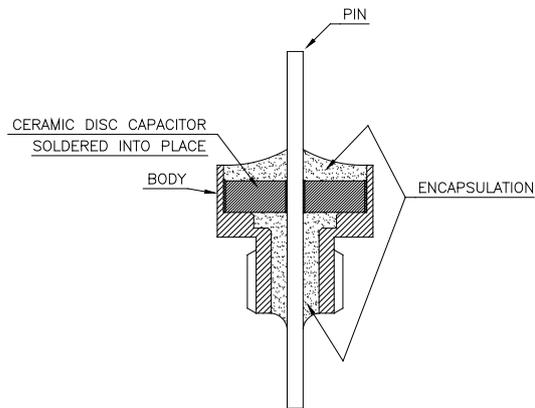


Fig 3
Typical EMI Filter
Construction

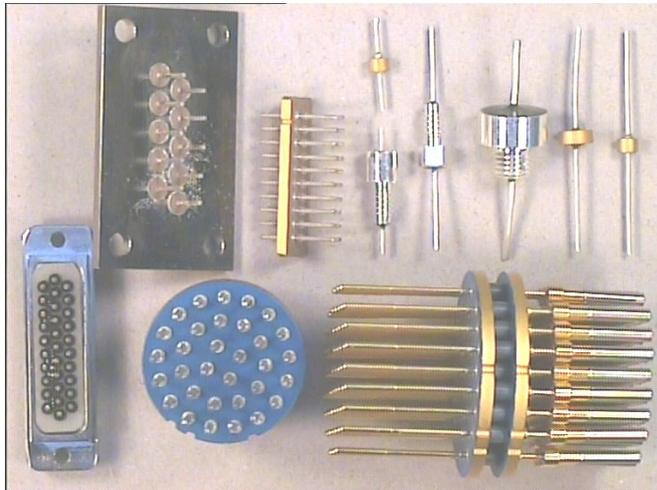



Fig 4
Examples of EMI Filters and
Assemblies

General soldering trials

It has been acknowledged for some years that soldering to the internal bore of the capacitor had the potential to induce cracks within the ceramic structure. The cracks generated by this process are known as 'Longbow' or 'Comma' cracks from their distinctive shape when viewed from a side cross section or top cross section respectively.

These cracks are usually benign, but if severe enough to extend into the area of electrode overlap (the active area) could cause total electrical failure. A longbow crack can possibly propagate through thermal cycling, but so long as it doesn't pass through the area of overlap, will still tend to be benign and cause no issues in most cases.

When a ceramic capacitor fails due to a crack passing through the active area, the failure will always tend towards a short circuit. If there is sufficient electrical power available, the part will then become extremely hot and can represent a source of combustion.

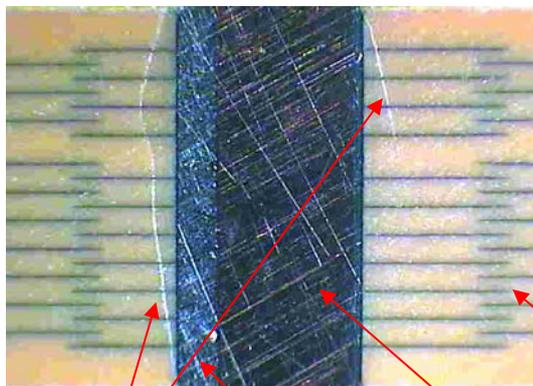

CRACKS

SOLDER JOINT


COPPER ALLOY PIN

CERAMIC CAPACITOR

Fig 5

'Longbow Crack'

Capacitor soldered using inappropriate solder alloy. Crack in dielectric material generated during cooling of solder joint after reflow.

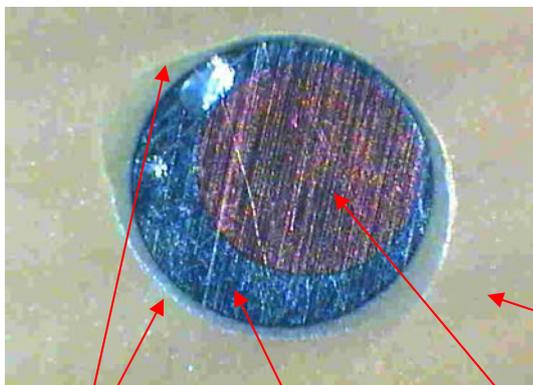

CRACKS

SOLDER JOINT

COPPER ALLOY PIN

CERAMIC CAPACITOR

Fig 6

'Comma Crack'

The same crack as in Fig 3 above, but sectioned through a plane 90° displaced.

Cracks in the dielectric material may result in catastrophic electrical breakdown of the capacitor if they propagate through the active electrode area.

A further form of crack commonly found in through hole ceramic capacitors is the corner crack. This occurs when the solder fillet on the surface pad shrinks causing the ceramic to crack and lift. It can be likened to the effect of pad lift on a circuit board.

Corner cracking is less critical than longbow / comma cracking and rarely threatens immediate outright dielectric failure, although the induced crack can propagate in operation causing failures. It can be eased by limiting the volume of solder in the meniscus or reducing the pad size. On very small size parts, it is common to remove the pad entirely.

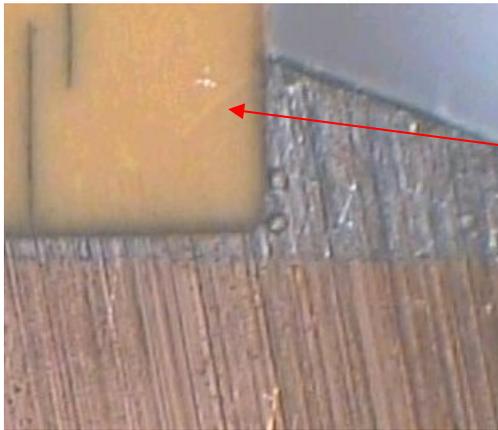


Fig 7

'Corner Crack'

Crack generated by lifting of the pad due to the solder meniscus

Investigation into cause of cracks

Investigation into causes of the cracks centred on the solder profile. In particular, it was felt important to understand whether the crack occurred during the heating or cooling portion of the solder profile. To this aim, an array was assembled using 62Sn/36Pb/2Ag solder and the solder was reflowed using a five zone hot air reflow furnace. As the array passed out of the final soldering zone, a number of pins were removed. After cleaning and drying, the array was sectioned and the internal structure analysed – cracks were found in the structure around holes with pins still in place. Where the pins had been removed no longbow cracks were present.

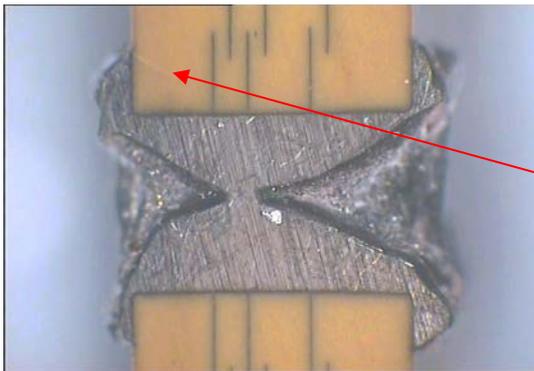


Fig 8

Example of solder joint from which pin has been removed before solder has solidified

Note small corner crack caused by solder meniscus

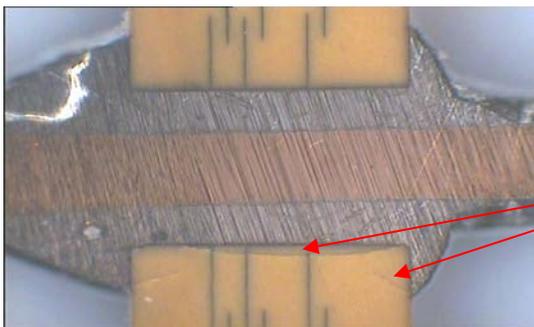


Fig 9

Example of solder joint with pin in place

Note longbow crack and corner cracks

This showed that the cracks only occur during the cooling portion of the soldering profile, and that pins must be present to generate the forces that form the longbow crack. This shows that the forces exerted on the ceramic are external to the capacitor.

Considering the forces being generated during the cooling cycle, it is clear that the critical force is generated by the shrinkage of the solder / pin as it cools. This force is generated by the mismatch between the shrinkage amount and rate of the ceramic / solder / pin interconnection. To prevent the cracking it is necessary to change the properties of this interconnection.

Ceramic dielectric (the same material as used by chip capacitor MLCC's) is a sintered brittle material selected primarily for its electrical properties. All ceramic dielectrics are liable to mechanical stress cracking and many papers relating to mechanical cracking of MLCC's can be found online. There are no ceramic dielectric materials currently available that have an inbuilt ductility or crack resistance.

The pin material used in this type of component is copper, brass and very occasionally steel, chosen for its machinability and electrical conductivity. For reference, the tests reported on below were conducted with silver plated copper pins, which is the most malleable of the pin materials normally used.

This leaves us to determine the relationship between solder alloy used and the cracks formed.

Solder alloy trials

To analyse the effects of different solder alloys, a set of trials were carried out using the following alloys:

- 62Sn/36Pb/2Ag Traditional LMP solder
- 60Sn/40Pb Traditional solder
- 99.3Sn/0.7Cu Lead free 'plumbers' solder
- 95.5Sn/3.8Ag/0.7Cu Lead free solder recommended for PCB assembly
- 50Pb/50In Ductile stress relieving solder
- 95Pb/5In Ductile stress relieving HMP solder
- 93.5Pb/5Sn/1.5Ag Ductile stress relieving HMP solder

This matrix represents the solders currently in use for the assembly of EMI filters, conventional tin lead solders and samples of lead free proposed replacement solders.

In each case except the 2 HMP alloys, two sample sets of filters were assembled and reflowed using a five zone hot air reflow furnace. Sample 1 had a standard solder profile with forced cooling by air blowers after zone 5. Sample 2 was reflowed using the same soldering profile but with the cooling air blowers turned off to allow gradual cooling, so as to reduce the stresses on the ceramic.

95Pb/5In solder has a high melting point of 300°C/313°C, and 93.5Pb/5Sn/1.5Ag a high melting point of 296°C/301°C, so neither could be soldered using the available hot air furnace. Instead samples of these were assembled using a hot plate at 425°C. Preheat was not used. Sample 1 parts were force cooled by placing directly in front of a desk fan. Sample 2 parts were allowed to gradually cool.

The samples were then sectioned, allowing the capacitor structure around the solder joints to be inspected for cracking.

Results

1) Solder Type 62Sn/36Pb/2Ag

Sample 1 (Forced cooling)

80% of the joints sectioned had longbow cracks adjacent to the solder joint. All the joints inspected had some cracking present in the ceramic, mostly corner cracks..

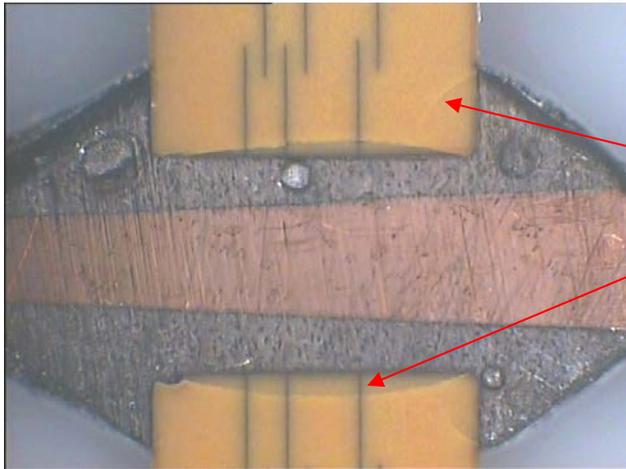


Fig 10

Example of force cooled
62Sn/36Pb/2Ag solder joint
showing longbow and corner
cracks

Sample 2 (Gradual cooling)

20% of the joints sectioned had longbow cracks adjacent to the solder joint. A total of 60% of joints had corner cracks associated with the solder meniscus.

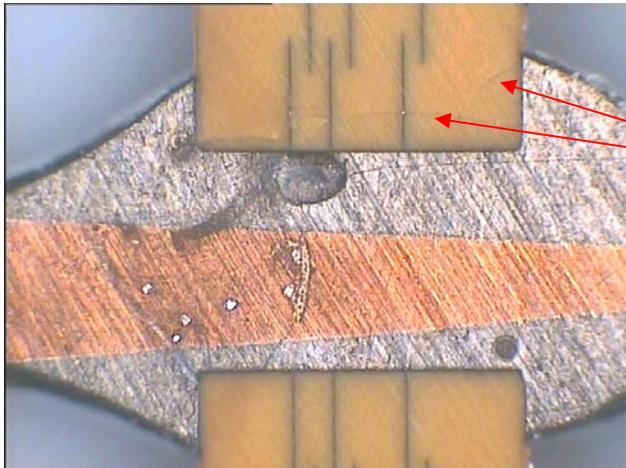


Fig 11

Example of 62Sn/36Pb/2Ag
solder joint showing
longbow and corner cracks

2) Solder Type 60Sn/40Pb

Sample 1 (Forced cooling)

All of the joints sectioned had longbow cracks adjacent to the solder joint. All joints also has corner cracks.

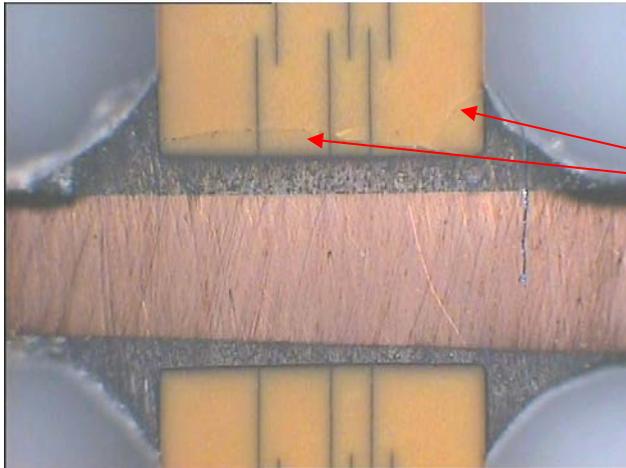


Fig 12

Example of force cooled 60Sn/40Pb solder joint showing longbow and corner cracks

Sample 2 (Gradual cooling)

60% of the joints sectioned exhibited longbow cracks adjacent to the solder joint. A total of 80% of joints had corner cracks associated with the solder meniscus.

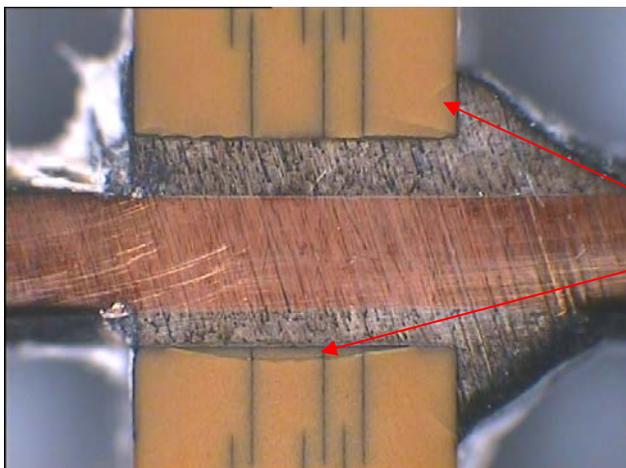


Fig 13

Example of 60Sn/40Pb solder joint showing longbow and corner cracks

3) Solder Type 99.3Sn/0.7Cu

Sample 1 (Forced cooling)

All of the joints sectioned had longbow cracks adjacent to the solder joint. All joints also has corner cracks.

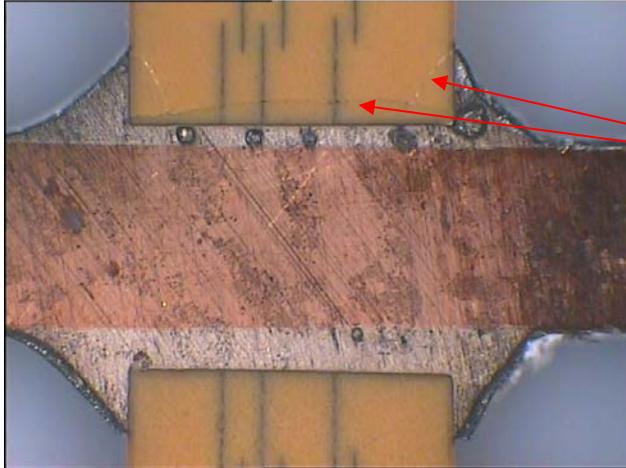


Fig 14

Example of force cooled 99.3Sn/0.7Cu solder joint showing longbow and corner cracks

Sample 2 (Gradual cooling)

All of the joints sectioned had longbow cracks adjacent to the solder joint. All joints also has corner cracks.

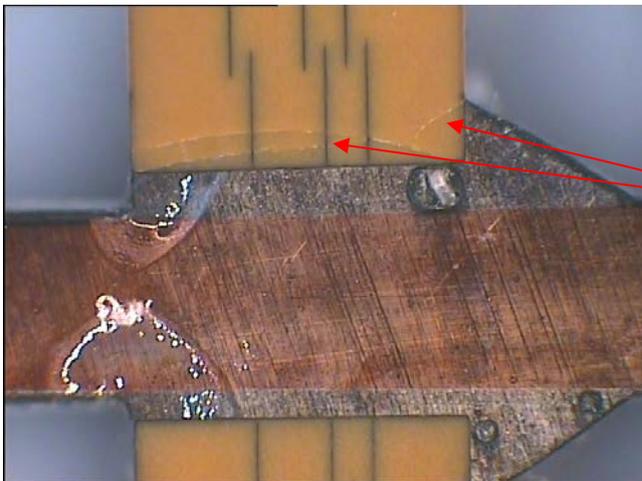


Fig 15

Example of 99.3Sn/0.7Cu solder joint showing longbow and corner cracks

4) Solder Type 95.5Sn/3.8Ag/0.7Cu

Sample 1 (Forced cooling)

All of the joints sectioned had longbow cracks adjacent to the solder joint. All joints also has corner cracks.

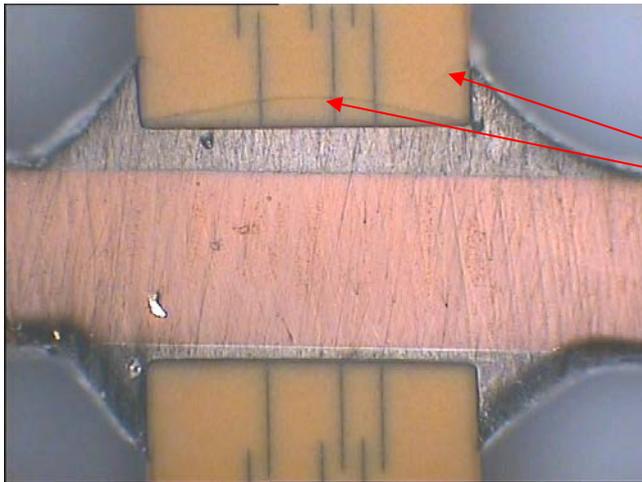


Fig 16

Example of force cooled
95.5Sn/3.8Ag/0.7Cu solder
joint showing longbow and
corner cracks

Sample 2 (Gradual cooling)

40% of the joints sectioned had longbow cracks adjacent to the solder joint. 80% of the joints in total had corner cracks, mainly corner cracks associated with solder pads.

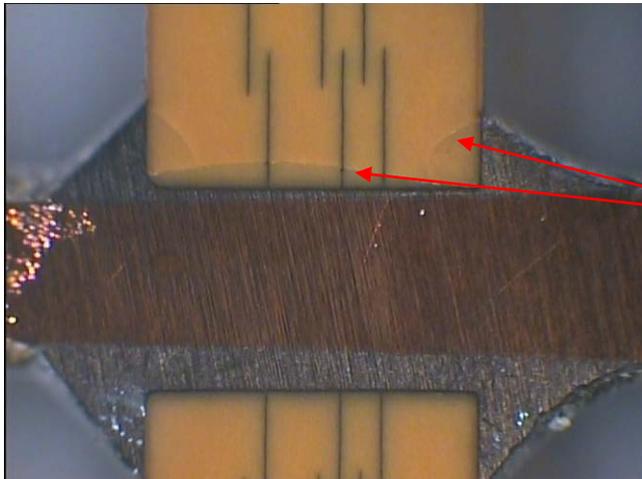


Fig 17

Example of 95.5Sn/3.8Ag/0.7Cu
solder joint showing longbow and
corner cracks

5) Solder Type 50In / 50Pb

Sample 1 (Forced cooling)

None of the joints sectioned exhibited any sign of induced cracks in the ceramic.

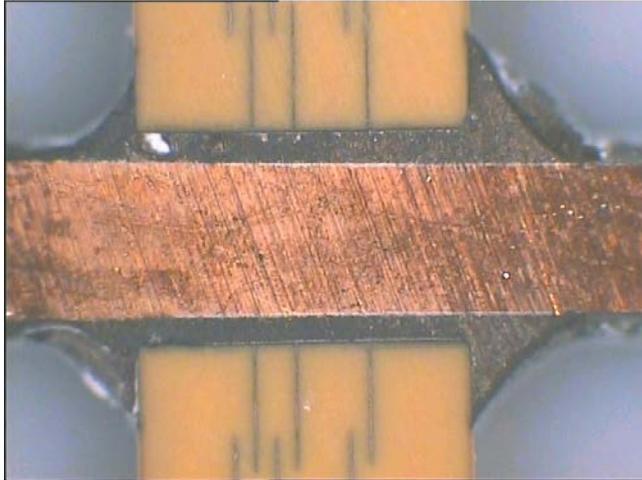


Fig 18

Example of force cooled
50Pb/50In solder joint
showing absence of any
cracks

Sample 2 (Gradual cooling)

None of the joints sectioned exhibited any sign of induced cracks in the ceramic.

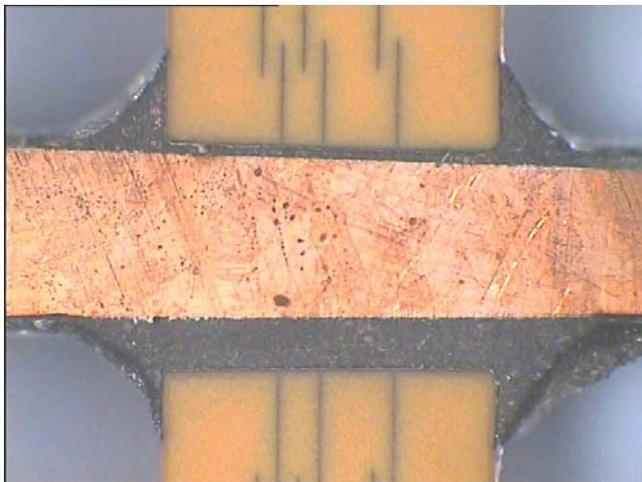


Fig 19

Example of 50Pb/50In solder
joint showing absence of any
cracks

6) Solder Type 95Pb / 5In

Sample 1 (Forced cooling)

None of the joints sectioned exhibited any sign of induced cracks in the ceramic.

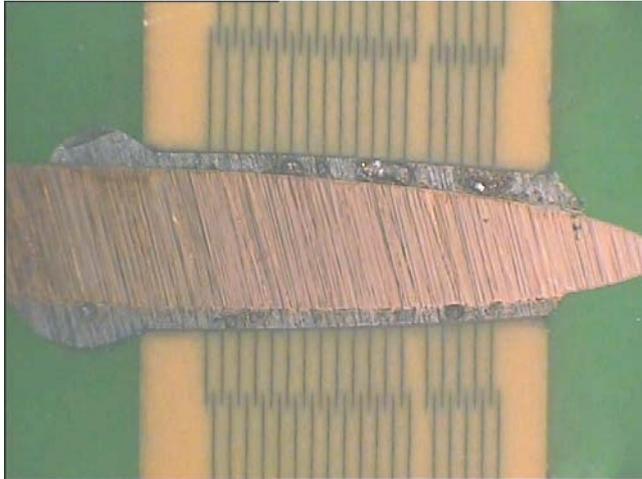


Fig 20

Example of force cooled
95Pb/5In solder joint showing
absence of any cracks

Sample 2 (Gradual cooling)

None of the joints sectioned exhibited any sign of induced cracks in the ceramic.

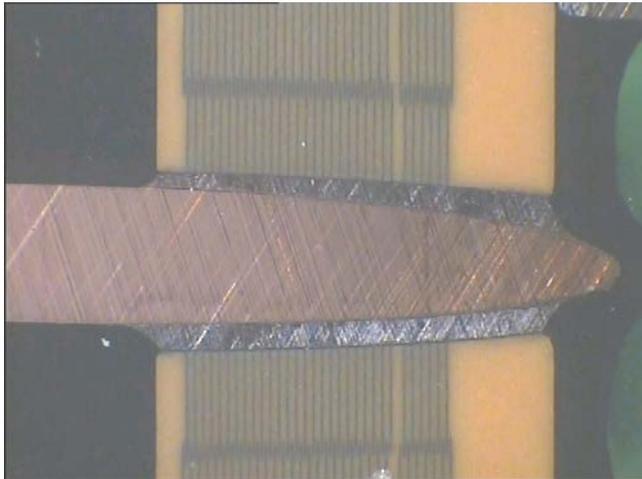


Fig 21

Example of 95Pb/5In solder
joint showing absence of any
cracks

7) Solder Type 93.5Pb/5Sn/1.5Ag

Sample 1 (Forced cooling)

10% of the joints inspected showed very small longbow cracks adjacent to the solder joint. These were noticeably smaller than the cracks seen in other samples.

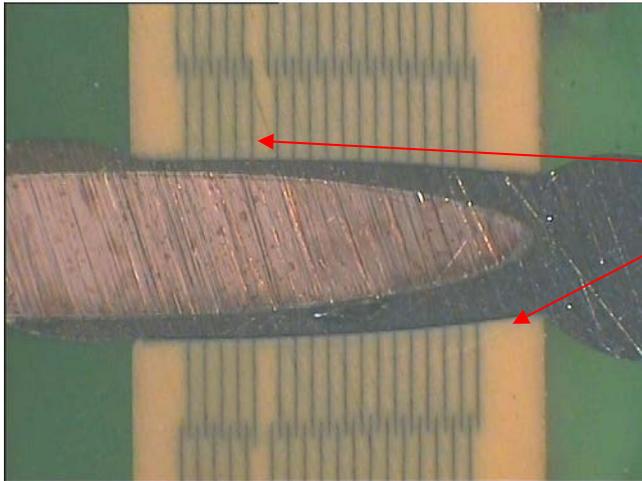


Fig 22

Example of 93.5Pb/5Sn/1.5Ag solder joint showing small longbow cracks.

Sample 2 (Gradual cooling)

None of the joints sectioned exhibited any sign of induced cracks in the ceramic.

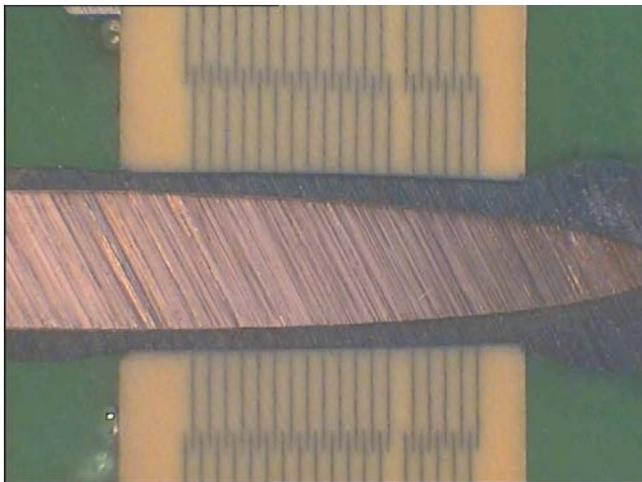


Fig 23

Example of 93.5Pb/5Sn/1.5Ag solder joint showing absence of any cracks

Results Summary

Alloy Type	Cooling	% Defective 'Longbow' only	% Defective Total
62Sn/36Pb/2Ag	Forced	80	100
	Gradual	20	60
60Sn/40Pb	Forced	100	100
	Gradual	60	80
99.3Sn/0.7Cu	Forced	100	100
	Gradual	100	100
95.5Sn/3.8Ag/0.7Cu	Forced	100	100
	Gradual	40	80
50Pb/50In	Forced	0	0
	Gradual	0	0
95Pb/5In	Forced	0	0
	Gradual	0	0
93.5Pb/5Sn/1.5Ag	Forced	10	10
	Gradual	0	0

Note:

The HMP solder joints were made using capacitors without solder pads as available jigging did not allow padded parts to be assembled. This eliminated corner cracking and may have slightly distorted the results with respect to this. However, the very low level of longbow cracking found in HMP soldered parts (10% of force cooled 93.5Pb/5Sn/1.5Ag joints only) still indicates the improved performance of these alloys.

As mentioned above, very small longbow cracks are usually benign and close enough to the through pin not to extend through the active electrode area and cause electrical breakdown.

Demonstration of effect with PdAg termination

PdAg terminations raise another problem with soldering to through holes in ceramic - the termination to ceramic bond is reduced when compared to gold plating. The effect of this is that the contraction forces tend to stress relieve the assembly at the termination / ceramic interface rather than inside the ceramic structure in the form of a crack.

On the face of it, this may appear better than a potentially fatal crack, but it raises a potentially more worrying concern.

If a ceramic capacitor is cracked, and subsequently fails, then the resulting fail is almost always a short circuit IR failure. This is normally immediately apparent and the resulting failure can be isolated and removed.

Failure of the termination / ceramic interface will tend not to cause an immediate obvious failure, but will instead result in loss of the filtering performance, often due to dropping capacitance. There have been cases of total loss of filtering due to total failure of the termination / ceramic interface. Loss of filtering may not be immediately apparent, but the effect on the performance of the overall system can be far worse.

Testing PdAg termination and Pb free solder alloy

To demonstrate the problems experienced with soldering to PdAg termination it is easiest to consider a design of capacitor where the capacitance is constructed without electrodes connected to the through hole.

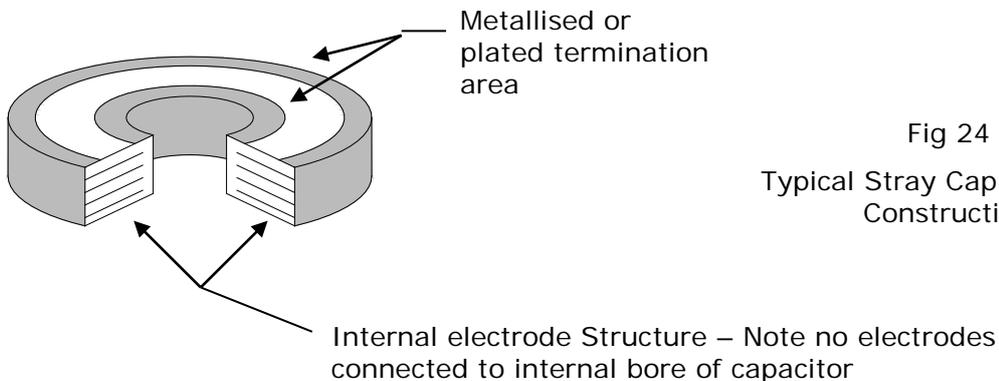


Fig 24
Typical Stray Cap. Discoidal
Construction

The capacitance is created by the interaction of the internal bore termination and the outer earth electrodes.

The advantage of carrying out experiments with this type of construction is that any failure of the internal termination or ceramic cracking is demonstrated by a drop in the capacitance. This is because of the introduction of an alternative dielectric material – air – in the area of the failure.

Tests were carried out using capacitor arrays with the electrical design shown above and terminated with PdAg termination material. Prior to assembly, the capacitance of the holes with this design was recorded. The assembly was soldered using 95.5Sn/3.8Ag/0.7Cu solder and hot air reflow. After assembly, the capacitance was re-measured and the results tabulated below.

Test Results

Start Capacitance (pF)	Array No. 1		Start Capacitance	Array No. 2	
	Capacitance after Soldering (pF)	Change (%)		Capacitance after Soldering	Change (%)
551	296	-46.3	539	331	-38.6
550	242	-56.0	540	256	-52.6
550	300	-45.5	535	196	-63.4
552	249	-54.9	536	189	-64.7
553	244	-55.9	532	323	-39.3
546	474	-13.2	538	151	-71.9
544	351	-35.5	536	91	-83.0
543	418	-23.0	539	175	-67.5
551	339	-38.5	544	353	-35.1
551	520	-5.6	536	168	-68.7
546	368	-32.6	536	176	-67.2
550	289	-47.5	534	317	-40.6
544	451	-17.1	544	173	-68.2
544	443	-18.6	543	153	-71.8
550	242	-56.0	543	285	-47.5

Array No. 1

Mean Drop = 36.5%

Maximum Drop = 56.0%

Array No. 2

Mean Drop = 58.7%

Maximum Drop = 83.0%

Analysis of the Cause of failure

The capacitor arrays were surface sectioned to check for the presence of cracks in the ceramic. Using this method of sectioning analysis allows us to investigate all solder joints at once. If cracks are found, they will be of the 'Comma' variety described above.

Surface sectioning of both arrays found no ceramic cracks.

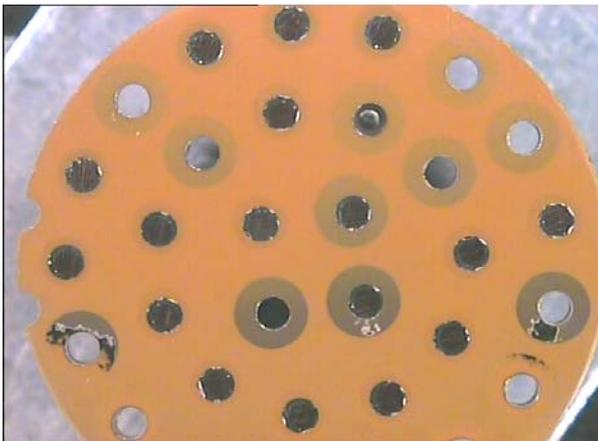


Fig 25

Surface Section of Array No. 2
showing absence of damage to
ceramic

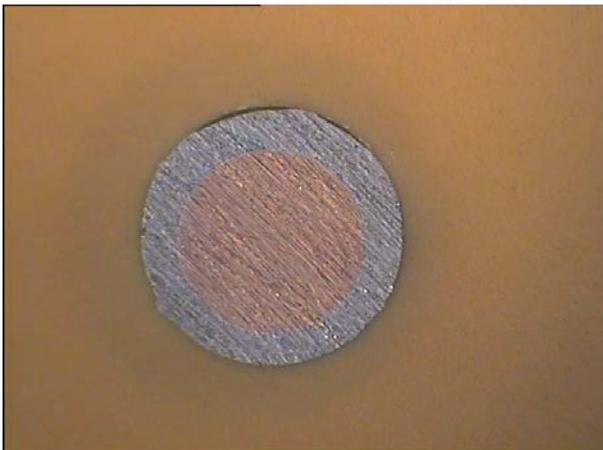


Fig 26

Close-up of Surface Section of Array
No. 1 showing absence of damage to
ceramic

We can therefore conclude that the capacitance loss is not caused by cracks within the ceramic in the same way that gold terminated parts are affected.

One effect that can be seen from the surface sections above is that of solder / termination pull – away from the bore of the ceramic. This has the same effect as the cracks in gold plated parts, introducing a section of air dielectric within the capacitor build.

This effect can be seen in FIG 26 above. A further example is below:

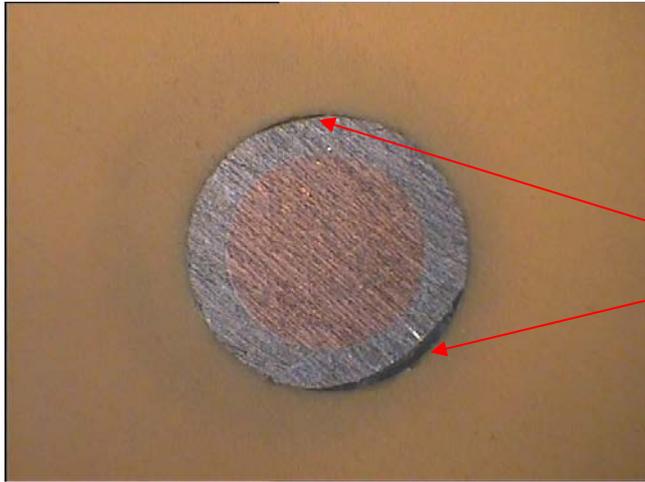


Fig 27

Second Close-up of Surface Section of Array No. 1 showing absence of damage to ceramic, but evidence of pull away of solder / termination from ceramic surface.

It is our conclusion that the unacceptable capacitance drop is caused by the failure of the termination / ceramic bond when exposed to excessive stress force as the solder / pin joint cools.

Analysis of the differences between gold plate and PdAg terminations

To understand the failure mode above, it is necessary to investigate the differences between PdAg termination and gold plate.


1. With PdAg termination, the bond to the ceramic is far weaker than gold plate termination. This can be demonstrated by a simple pull test, as below.

Fig 28

Silver plated copper pins soldered into planar array capacitors using 95.5Sn/3.8Ag/0.7Cu solder and removed by simply pulling out using a pair of pliers.

Pins 1 & 2 have been pulled from an array terminated with gold plate.

Pins 3 & 4 have been pulled from an array terminated with PdAg fritted termination.

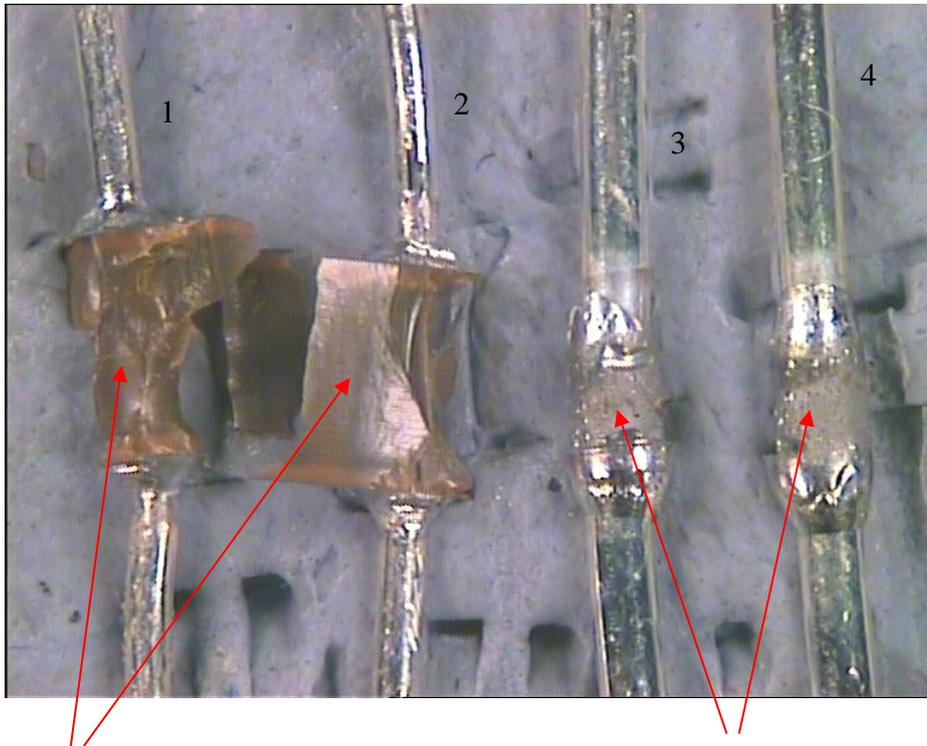

Fractured ceramic remaining attached to the feedthrough pin after attempting to pull the pin out.

On closer inspection its possible to see the internal electrode structure of the capacitor.

Both demonstrate the characteristic shape of the longbow / comma crack in the way the ceramic fractured

Remains of PdAg termination can be seen on the otherwise 'clean' solder joint on pins 3 & 4

As can be seen above, the gold plated termination has a far greater adhesion to the ceramic, demonstrated by the amount of ceramic material still attached to the pin. By comparison, the PdAg termination has been cleanly removed from the ceramic with no ceramic material removed. Pins 3 and 4 do show the PdAg termination still attached to the solder – identified by the dull grey areas on the solder.

This is further shown in FIG 29, where the pins have been removed from a partially sectioned array soldered with PdAg termination.



Application Note
Reference No: AN0011
Solder Alloy Choice for
Through Hole Ceramic
Discoidal & Planar Array
Capacitors Issue 10

Page 23 of 27

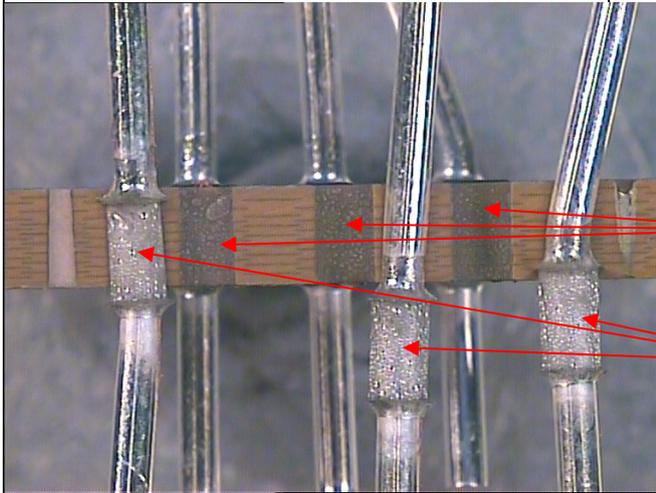


Fig 29

Example of PdAg terminated planar array capacitor soldered with 95.5Sn/3.8Ag/0.7Cu solder.

As the component is sectioned, the pins can be easily removed without damage to the ceramic.

Note the dark grey on the solder joint – this is the termination, which has been removed along with the pin & solder.

The ceramic exhibits no damage, and the pins are very easily removed – the termination has relatively little adhesion to the ceramic.

2. Secondly, PdAg termination is far more susceptible to leaching into the molten solder as the joint is formed. In sectioned components, this is observed as areas of missing termination within the bore of the component.

Leaching is far more common with Pb free alloys, and has been observed on PdAg terminated components with all Pb free alloys. The following examples have been soldered using 95.5Sn/3.8Ag/0.7Cu solder alloy.

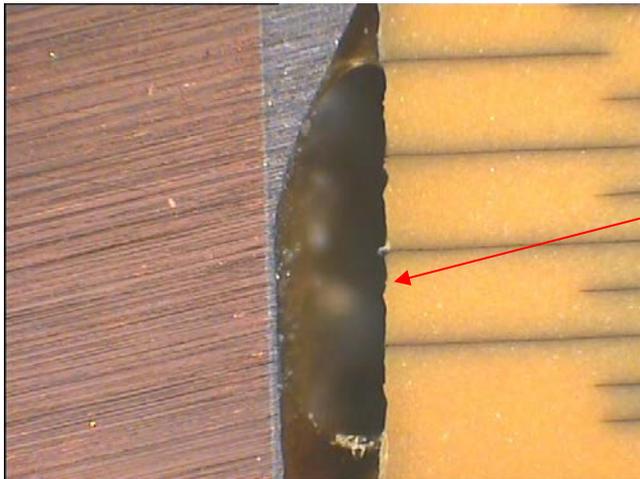


Fig 30

Termination leached away from this area.

These electrodes have lost contact and will result in a potential reduction in filtering performance.

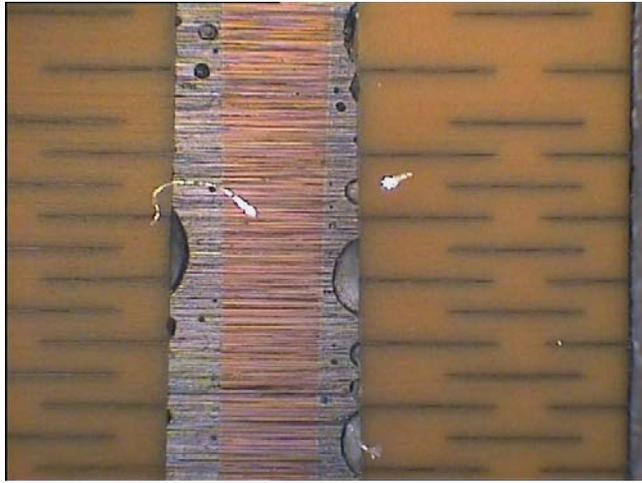


Fig 31

Further example of leaching and poor solder joint with PdAg termination.

This leaching also has the effect of reducing the termination adhesion between the termination and the ceramic.

Comments on fritted termination in discoidal and planar capacitors

From this analysis it is clear that PdAg terminations are not suitable for through hole ceramic devices when soldered with lead free solder alloys. Although the ceramic does not crack in the same way as gold plated terminated parts do, the joint between the termination and the ceramic is compromised resulting in a parametric failure.

It is important to also understand that the results given in this paper only represent analysis after the soldering operation. It is normal practise for this type of component to be subjected to positive and negative thermal excursions during testing and operation. It is reasonable to expect that the effect can propagate during these excursions, with the possible conclusion of total joint failure.

The possible loss of up to 83% of design capacitance (ref. results table P19) is clearly unacceptable, but may not be immediately apparent in operation. Components which have had cracks induced (i.e. gold plated termination) are likely to fail short circuit – a failure mode that is immediately observed allowing the failed component to be isolated and removed.

Parametric failure, such as loss of capacitance, is a far more insidious failure mode in that it may not be easily detected, but can cause serious and significant problems in operation.

In the example above, the design capacitance is 500pF, giving a typical PI filter (1000pF total) insertion loss of 6dB @ 10MHz. If we assume that this capacitance can drop to typically 250pF (500pF total - 50% drop), then the resultant insertion loss will only be in the region of 2dB @ 10MHz. The generally accepted cut-off point for a filter to be operating is 3dB. In its failed form the filter is not acting as such.

This failure may not be immediately critical, but the filter is not working to its design performance. If at some point in time, the filtering performance at this frequency is critical, then the performance is not available. When specifying the capacitance of a filter, allowance is made for capacitance change due to known and controlled effects such as capacitance ageing. Capacitance loss due to soldering issues are not controlled changes and as such cannot be allowed for in the design. Any capacitance loss due to soldering issues cannot be considered acceptable.

Conclusions

1. Severe cracks were found in all assemblies manufactured with both conventional tin lead solders and the proposed lead free alloys and gold plated termination.
2. Tin lead alloys induced cracks in the ceramic dielectric and should not be used for the manufacture of these assemblies.
3. Lead free alloys performed worse of all solders under test, and should not be used for the manufacture of these assemblies. The lead free alloys tended to perform worse than the tin lead alloys – more cracks and larger cracks were found.
4. In order to manufacture reliable safe capacitor assemblies, it is essential to use a ductile solder so as to prevent excessive force being transferred to the ceramic dielectric material. Ductile solders tend to be an alloy of lead and indium.
5. High melting point alloys, typically containing >90% lead and melting around 300°C, are acceptable if indium is to be avoided - but have a narrower processing window and are more susceptible to problems if the cooling rate is not controlled.

Obviously the use of these alloys increases the total amount of lead used in the assembly, but also the higher soldering temperatures required mean increased energy consumption and specialist soldering equipment. It is often necessary to use vacuum or atmosphere systems to prevent surface oxidation.
6. Solder joint design should be given due consideration. In particular, solder pads should be reduced or minimised (Note – the manufacture and testing of the capacitor itself will sometimes demand solder pads are included)
7. Gradual cooling should be used and force cooling, either intentional or unintentional due to factors such as drafts, should be avoided.
8. PdAg terminations reduce the incidence of ceramic cracking, but may result instead in parametric failure of the capacitor. This can be ultimately worse in service.
9. It is clear that there is a conundrum – if the termination system provides a very good bond to the ceramic, then there is a risk of cracking the ceramic. If the termination system provides a weak bond to the ceramic then there is a risk of parametric failure leading to loss of performance.
10. The best option for reliable performance is to use a termination system that provides a very strong bond to the ceramic (e.g. gold) and introduce stress relief through the use of ductile solders containing Lead and Indium.

RoHS compliance

EU directive 2011/56/EU (superseding 2002/95/EC), commonly known as RoHS directive, limits the use of certain substances in electronics manufacture. These substances include lead, which has forced a change from lead containing solders to lead free solders for a majority of applications.

Clearly from the evidence shown above, the use of lead free solders should be avoided when soldering to ceramic discoidal and planar capacitors.

The directive allows for exemptions to be granted for situations where there is no technical alternative or such alternatives constitute a negative environmental impact. Knowles (Syfer) have successfully applied for the use of lead containing solders for soldering to ceramic planar arrays and discoidal capacitors to be made exempt from the directive.

This exemption is detailed in the annex to the directive as follows:

Exemption No. 24 Lead in solders for the soldering to machined through hole discoidal and planar array ceramic multilayer capacitors.

Issued in the addendum to directive 2002/95/EC dated 14th October 2006 and continued in the revised directive 2011/56/EU of 1st July 2011.

The exemption was extended and reworded in the annex to the directive of 27/02/2018 C(2018) 1080 final

To summarise – Filters, filter assemblies and filtered connectors manufactured with Knowles (Syfer) discoidal and planar capacitors can be assembled using lead bearing solder alloys – i.e. InPb – to eliminate the incidence of micro cracking due to mismatched material shrinkages and still be RoHS compliant in this respect.